



شركة حائزة على شهادة
نظام إدارة الجودة
= UNI ISO 9001 =

كتيب تعليمات الاستعمال والصيانة

المحركات الغير متزامنة الأحادية الطور. سلسلة VMB / VMC

المحركات الغير متزامنة الثلاثية الطور. سلسلة VT1-2VTB 3VTB / VTB / VDV

معلومات السلامة

تم إعداد كتيب التعليمات على أساس توجيهات المجلس الأوروبي العيارية رقم 2006/42 CE، «التوجيه الخاص بالألات» والمواصفات الأوروبية رقم EN 60204-1 «مواصفات المعدات الكهربائية الآلات الصناعية» وEN 12100-2 «مواصفات سلامة الآلات - المبادئ العامة للتصميم - المواصفات والمبادئ التقنية». وتم أيضا إيراد جميع الاقتراحات والتعليمات المستمدة من التجربة العملية اللازمة لضمان الاستخدام السليم والأمن للمحرك كهربائي.



تحذير!

من الضروري قيام موظفين مؤهلين بالإجراءات الأساسية بتجهيز محطة المعدات. وعمليات التجميع والتكريب والتشغيل والصيانة. وتحت إشراف وفحص المسؤولين عن الجهاز الفني.

من الضروري قيام موظفين مؤهلين بالإجراءات الأساسية بتجهيز محطة المعدات. وعمليات التجميع والتكريب والتشغيل والصيانة. وتحت إشراف وفحص المسؤولين عن الجهاز الفني.

إرشادات التركيب والاستخدام

المحرك الكهربائي مكون مرتبط ميكانيكيا بالآلة متفرقة أخرى أو جزء من مكونات محطة من عدم معدات مرتبطة فيما بينها. وبالتالي فمن الضروري من يقوم بتركيب ضمان المطابقة لعمية المتطلبات والتوصيات الواردة بالتعايير EN 60204-1 حول المعدات الكهربائية الآلات ومستوى السلامة التي تضمن عليها التوجيه 2006/42 CE.

يخرج المحرك من المصنع بعد ضروره يفحص وضوابط جودة دقيقة خلال دورة الإنتاج وبعد خضوعه لاختبارات نهائية للتحقق من استجابته لمتطلبات المشروع. وجاهر للتركيب.

يرجى فحص المحرك عند الاستلام للتحقق من عدم تعرضه لأي نوع من الضرر أثناء النقل. إذا تم بعد استعمال المحرك فورا بعد الاستلام فيجب تخزينه في مكان مغفلي ونظيف. وخالي من الرطوبة.

يجب القيام بعمليات الفحص والصيانة أثناء التشغيل. يجب وضع المحرك على قاعدة مستوية متينة من أجل امتصاص الاهتزازات. ومن الصلابة ما يكفي للحفاظ على استقامة المحاور (المخاداة).

يجب تركيب المحرك دائما على الشكل الصحيح خاصة إذا تم توصيله مباشرة إلى آلة بحركها. في حالة وقوع اهتزازات أو خلل بالمندرجات (الحامل) يرجى خلق فورا من استقامة المحاور (المخاداة).

لما قد يتعرض له من انحراف. يمكن نقل الحركة إلى الآلة الموصولة بالبرك مباشرة. من خلال أحزمة نقل الحركة. التروس. وما شابه ذلك. في حالة التوصيل المباشر. يجب استخدام وصلات مطاطية أو وصلات مرنة لتجنب احتمالات وقوع دفع محوري على المحرجات. في حالة التوصيل بواسطة

أحزمة نقل الحركة. فيجب تركيب المحرك وعمود دورانه موازيا للعمود الآلة التي بحركها وعلى جهاز التحكم في ضغط توتر الحزام. يجب وضع في الاعتبار أن التوتر المفرط يؤثر على مدة المحرجات. وفي الحالات الخطيرة. قد يسبب في كسر العمود.

ما لم يتم التوصيل على خلاف ذلك. فالوزانة الديناميكية للعضو الدوار تتم بواسطة نصف مفتاح. كما يجب موازنة مكونات حركة النقل بعناية قبل التجميع. يجب جميع وتفكيك مكونات التوصيل والمحرجات بطرق وأدوات مناسبة لهذا الغرض. قبل وضع المحرك في الخدمة

بعد فترات طويلة من عدم الاستخدام أو التخزين. يجب التحقق من قيمة مقاومة عزل الملفات في درجة حرارة البيئة المحيطة أي حوالي 25 درجة مئوية أكثر من 1MOhm (ميجا أوم). أما إذا سجلت قيما أقل. فهذا يعني أن نسبة الرطوبة في الملفات متفرقة بشكل خطير. ولهذا يجب تنظيفها من لدن شذوكة متخصصة. يجب أن يتم الربط الكهربائي والآلة متوقفة. ومفصولة

عن التيار الكهربائي. ومراعاة بدقة قواعد السلامة الواردة في التوجيه رقم EN 60204-1. يجب أن يتم التوصيل بالتيار الكهربائي وفق التوجيهات الواردة في المخطط الموجود داخل إما غطاء علبة الرأس أو داخل صندوق حامل المكثف. يجب توصيل سلك التنازيل إلى الكَيْسَة المميرة بعلامة

التأريض. يجب أن تكون الأسطح المتلامسة نظيفة ومحمية من التآكل.

الحركات القياسية يمكن تشغيلها في أي اتجاه الحركة. يمكن عكس اتجاه الحركة عن طريق توصيل الكَيْسَات بواسطة اللوحات الخاصة كما هو مبين في الرسم البياني. يجب استخدام

كابلات ذات مقطع عرضي ملائم لتحمل شدة التيار المتصق قبل المحرك لتجنب ارتفاع الحرارة المفرط و/ أو انخفاض الجهد الكهربائي. يجب أيضا منع الكابلات من نقل أي إجهاد ميكانيكي على كَيْسَة المحرك. وفي الختام خلق من جميع التوصيلات. وتأكد من الإغلاق الجيد والحكم خملات

الترنق وغطاء علبة التوصيلات الطرفية و/أو صندوق حامل المكثف. لضمان أعلى درجات الحماية. خلق من دوران العمود بحرية. يمكن تشغيل أغلب المحركات الغير متزامنة الأحادية الطور المحرجة

بالعضو الدوار ذو القفص. بعلمية بدء تشغيل مباشر. بعد التحقق من الآلة في علاقتها بشدة التيار المتصق خطية بدء تشغيل.

من المستحسن دائما تشغيل المحرك بواسطة جهاز مزود بمرحل relay للحماية ومعايرته لشدة التيار المناسبة. لا يجب أن تدخل حماية المحرك بسبب شدة تيار بدء التشغيل.

نوصي أيضا بالتحقق من زيادة أو نقصان الجهد الكهربائي للمحرك. أثناء تشغيله. عن الجهد الاسمي بنسبة: $\pm 5\%$. وأن لا تزيد شدة التيار المتصق عن القيمة الواردة باللوحة. حرارة الغطاء

الخارجي للمحرك لا تعتبر مؤشرا سليما للتأكد على سلامة المحرك. المحرك الذي يبدو «باردا» من الخارج. قد يكون حجم الضرر الذي وقع أكبر أو أصغر من ارتفاع الحرارة المفرط بملفات المحرك الذي يبدو «ساخنا» من الخارج.

الصيانة

عملا بالقواعد السليمة. ينبغي فحص المحركات دوريا للتحقق من عملها دون اهتزازات أو ضجيج غير عادي. ولا تتجاوز شدة التيار المتصق القيمة المشار إليها باللوحة المعدنية للمحرك. وأن يدخل الهواء الواقع يغطاء المروحة غير مسدود وعدم تراكم آثار الغبار. والنفط أو غيرها من الشوائب على المحرك. تستخدم محركات الاستخدام العادي مدحرجات منسجمة مسبقا من النوع التالي الدرع:

وبما أنها ذاتية التشغيل فهي لا تحتاج إلى صيانة. تبلغ مدة خدمتها أي دورة حياتها التقنية 20.000 ساعة التشغيل. أي على أبعد تقدير بعد 3 سنوات. أخذًا بعين الاعتبار الأحمال المحرورة أو الشغاعية المطلوبة في العمود. والحرارة والظروف البيئية للاستخدام.

فقط الغيار

قطع الغيار. متاحة تحت الطلب. بعد تزويدنا بنوع المحرك الواردة باللوحة المعدنية.

Three phase motors series VTB 4 poles V220/380-60 Hz

| Motor type | Potenza Rated output | Velocità Rated speed | Tensione Rated voltage | Frequenza rated frequency | Corrente Rated current | Corrente Starting current | Coppia nominale Rated torque | Coppia spunto Starting torque | Jm Motor inertia | Jext Load inertia | |
|------------|----------------------|----------------------|------------------------|---------------------------|------------------------|---------------------------|------------------------------|-------------------------------|------------------|-------------------|--------|
| series | HP | KW | r.p.m. | V | Hz | A | A | Nm | Nm | Nmg | |
| VTB 63 A | 0.17 | 0.12 | 1630 | 380 | 60 | 0.50 | 1.4 | 0.71 | 1.95 | 0.0021 | 0.0054 |
| VTB 63 B | 0.25 | 0.18 | 1640 | 380 | 60 | 0.75 | 2.2 | 1.07 | 2.80 | 0.0026 | 0.0067 |
| VTB 63 C | 0.33 | 0.25 | 1640 | 380 | 60 | 0.93 | 2.8 | 1.48 | 3.80 | 0.0029 | 0.0075 |
| VTB 71 A | 0.50 | 0.37 | 1660 | 380 | 60 | 1.30 | 3.7 | 2.17 | 5.50 | 0.0069 | 0.0179 |
| VTB 71 B | 0.50 | 0.37 | 1660 | 380 | 60 | 1.30 | 3.7 | 2.17 | 5.50 | 0.0069 | 0.0179 |
| VTB 71 C | 0.75 | 0.55 | 1660 | 380 | 60 | 1.70 | 5.4 | 3.22 | 8.30 | 0.0091 | 0.0236 |
| VTB 80 A | 0.75 | 0.55 | 1670 | 380 | 60 | 1.70 | 6.5 | 3.22 | 8.80 | 0.0160 | 0.0390 |
| VTB 80 B | 1.00 | 0.75 | 1680 | 380 | 60 | 2.20 | 9.1 | 4.35 | 10.5 | 0.0188 | 0.0413 |
| VTB 80 C | 1.50 | 1.10 | 1680 | 380 | 60 | 3.00 | 12.9 | 6.38 | 14.6 | 0.0230 | 0.0595 |
| VTB 90 S | 1.50 | 1.10 | 1680 | 380 | 60 | 2.80 | 12.6 | 6.38 | 14.9 | 0.0204 | 0.0450 |
| VTB 90 L | 2.00 | 1.50 | 1680 | 380 | 60 | 3.70 | 17.4 | 8.70 | 19.5 | 0.0240 | 0.0530 |
| VTB 90 C | 3.00 | 2.20 | 1680 | 380 | 60 | 5.40 | 27.0 | 12.8 | 28.4 | 0.0330 | 0.0775 |
| VTB 100 LA | 3.00 | 2.20 | 1690 | 380 | 60 | 5.30 | 28.0 | 12.7 | 29.4 | 0.0457 | 0.1095 |
| VTB 100 LB | 4.00 | 3.00 | 1690 | 380 | 60 | 7.20 | 38.0 | 17.3 | 40.7 | 0.0566 | 0.1245 |
| VTB 112 MA | 5.50 | 4.00 | 1700 | 380 | 60 | 9.30 | 54.0 | 22.9 | 53.0 | 0.1180 | 0.2124 |
| VTB 112 MB | 7.50 | 5.50 | 1710 | 380 | 60 | 12.7 | 76.0 | 31.3 | 71.4 | 0.1600 | 0.2880 |
| VTB 132 SA | 7.50 | 5.50 | 1720 | 380 | 60 | 12.0 | 79.0 | 31.1 | 73.6 | 0.2330 | 0.4190 |
| VTB 132 MA | 10.0 | 7.50 | 1740 | 380 | 60 | 16.0 | 109 | 42.0 | 96.5 | 0.2700 | 0.4860 |
| VTB 132 MB | 12.5 | 9.00 | 1740 | 380 | 60 | 20.0 | 140 | 51.5 | 118 | 0.3450 | 0.6210 |
| VTB 132 MC | 15.0 | 11.0 | 1750 | 380 | 60 | 24.0 | 168 | 61.2 | 141 | 0.3800 | 0.6890 |

قطع الغيار

قطع الغيار. متاحة تحت الطلب. بعد تزويدنا بنوع المحرك الواردة باللوحة المعدنية.



تحذير!

لنقل ومساواة المحركات ذات حجم أكبر. تم تجهيز سطح المحرك بنقوب مخصصة لتركيب عمود ملائمة. لا يجب رفع المحرك وباقي المعدات الموصولة به أثناء التثبيت.



تحذير!

يجب فصل التيار الكهربائي عند القيام بأي نوع من العمل على الآلة. يجب جميع وتفكيك مكونات التوصيل والمحرجات بطرق وأدوات مناسبة لهذا الغرض. تفكيك المحرك يتم عبر فصل جميع المكونات الموصولة بالآلة القربونة بالمحرك.



تحذير!

للتخلص من المنتج عند انتهاء دورة حياته. يجب الالتزام بالقوانين المحلية الجاري العمل بها. مع الأخذ في الاعتبار أن جميع المواد المكونة للمحركات الكهربائية قابلة لإعادة التدوير.



تحذير!


الحرك الكهربائي منتج مُعد للدمج في آلات أخرى أو للاستعمال في المناطق الصناعية. ولهذا لا بد من اتخاذ تدابير سلامة إضافية إذا دعت الحاجة إلى توفير ظروف حماية مفيدة.



تحذير!

يجب فصل التيار الكهربائي قبل القيام بأي إجراء على المحرك. يرجى الحذر من أي أجهزة للتدفئة (سخانات) التي قد تكون مزودة بتيار كهربائي بشكل منفصل.

المحركات الغير متزامنة الأحادية الطور سلسلة VMB / VMC :

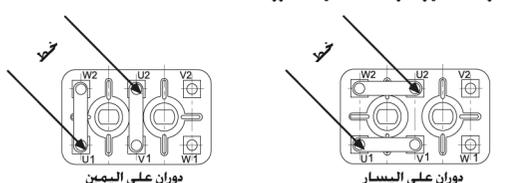


دوران على اليمين

دوران على اليسار

محركات غير متزامنة ثلاثية الطور VT1-2VTB 3VTB / VTB / VDV


طرق توصيل المحركات الوحيدة السرعة

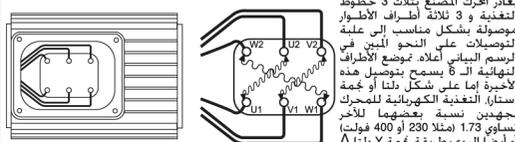


يعاد المحرك المصنع بثلاث 3 خطوط التغذية و 3 ثلاثة أطراف الأظفار موصولة بشكل مناسب إلى عملة التوصيلات على النحو المبين في الرسم البياني أعلاه مجموع الأطراف النهائية ال 6 يسمح بتوصيل هذه الأخيرة إما على شكل دلتا أو نجمة (سنتا) التغذية الكهربائية للمحرك بجهتين نسبة بعضها لآخر تساوي 1.73 (ملا 230 أو 400 فولت) وأيضا المبرم بطريقة نجمة Y دلتا Δ بواسطة جهاز إقلاع المحرك الخاص.

محركات غير متزامنة ثلاثية الطور VDV

طرق توصيل المحركات الثنائية السرعة. الوحيدة الملففة

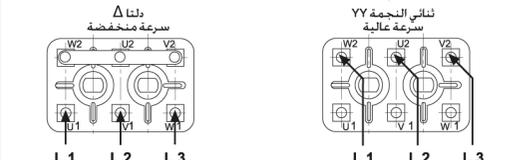

طرق توصيل المحركات الثنائية السرعة. ذو ليفتقان منفصلتان

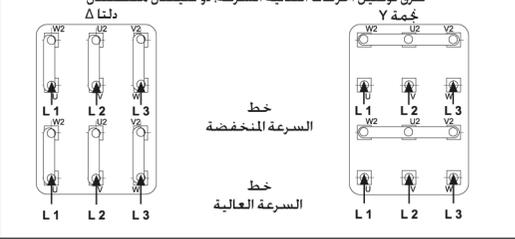

خط السرعة المنخفضة

خط السرعة العالية

الضمان

توفر شركة VEMAT MOTORI S.r.l. ضمانا لجودة وسلامة وموثوقية جميع منتجاتها. ويطي الضمان لمدة 12 شهرا بدءا من تاريخ التسليم. إن يتم تجديد الضمان تحت أي ظرف من الظروف. حتى وإن لم يتم تشغيل المحرك الماداة 1512 من القانون المدني. تعهدت شركة VEMAT SRL بإصلاح أو استبدال الأجزاء التالفة على نفقتها الخاصة في أقرب وقت ممكن في حالة ظهور عيوب في التصنيع. أو في التركيب أو في المواد المكونة للمحرك. تتم جميع عمليات الإصلاح والاستبدال بمصانعا. ويتحمل العميل جميع نفقات النقل والشحن. يعتبر الضمان لاغيا في حالة ظهور عيوب ناجمة عن الاستعمال الغير مناسب ومن قبل غير مؤهلين. أو الاستعمال الغير متوافق مع بيانات اللوحة المعدنية. أو نتيجة تغييرات نفذت أو تم تنفيذها من قبل العملاء دون ترخيص من الشركة المصنعة.



VEMAT MOTORI S.r.l.

Via Guolda, 10 Z.I.

36075 Montecchio Maggiore (VI) - Italy

Tel. +39 0444 491973 r.a.

Fax +39 0444 491978

e-mail: vemat@vemmat.it - www.vemat.it





MANUAL OF INSTRUCTIONS FOR USE AND MAINTENANCE

SERIES VMB / VMC SINGLE-PHASE ASYNCHRONOUS MOTORS
SERIES VT1-2VTB 3VTB / VTB / VTV / VDV THREE-PHASE ASYNCHRONOUS MOTORS

SAFETY INFORMATION

This instruction manual has been drawn up on the basis of the requirements laid down in Directive 2006/42 CE, "Machinery Directive", and according to the European standards EN 60204-1 "Electrical equipment of machines" and UNI-EN ISO 12100-2 "Safety of machinery - Basic concepts - General principles of design". This manual also includes detailed suggestions resulting from previous experience, which are necessary in order to guarantee the correct and safe use of the electric motor.



WARNING!

The basic arrangement, assembly, and installation work for the motors, including putting them into service, and any subsequent maintenance work, must be carried out by qualified personnel under the supervision of responsible technical staff.

INSTRUCTIONS FOR INSTALLATION AND USE

An electrical motor is a component which is mechanically connected to another single machine or installed as a constituent part of a plant. It is therefore the responsibility of whoever carries out the installation work to guarantee that it conforms with all the requirements and recommendations set out in the EC standards EN 60204-1 regarding electrical equipment of machines, and the degree of safety as laid down in Directive 2006/42 CE.

The motor leaves the factory ready for installation, after careful quality control inspections of its production cycle, and a final test to check that it conforms to the specifications of the project. It is recommended to examine the motor at the time of delivery to ensure that it has not been damaged during transport. If the motor is not to be put into service immediately, it must be stored in a covered place which is clean and free of humidity. It must be possible to carry out inspection and maintenance work while the motor is still running. The foundations of the motor must be level, strong enough to absorb the vibrations, and sufficiently rigid to maintain its alignment.

The motor must always be well installed, especially if it is directly connected to the machine being driven. In case of vibrations, or of faults in the bearings check the alignment, which could be incorrectly off-set. Power can be transmitted to the machine being operated by means of a direct connection, or of transmission belts, gears or other similar methods. In the case of a direct connection, an elastic or flexible joint must be used to avoid the transmission of any axial forces to the bearings. In the case of connections using transmission belts, the motor must be installed with the drive shaft parallel to that of the machine to be operated, and using a belt tightener in order to regulate the tension of the belts. The fact that excessive tension causes excess wear on the bearings, and in more serious cases, can cause the shaft to break, must be taken into consideration.

Unless otherwise indicated, the rotor is dynamically balanced by means of a half key, and the transmission components must be accurately balanced too, before assembly.

When assembling or dismantling the components for connecting and the bearings, use the method and equipment which are suitable for the purpose. Before putting the motor into service after long periods out of use, or in storage, check that the resistance of the insulation of the winding is greater than 1 M Ohm at an environmental temperature of about 25° C. If lower values are recorded, this means that the humidity of the winding is dangerously high, and it must be taken to a specialist company for drying.

The electrical connection must be carried out while the machine is at rest, and disconnected from the electrical power supply, while scrupulously respecting the safety standards set out in EN 60204-1. Connection to the electrical power supply must take place following the indications given on the diagram located inside either the header cover or the condenser holder box.

The earth wire must be connected to the terminal carrying the earth symbol, and the contact surfaces must be clean and protected from corrosion. Motors in standard production can operate equally in both running directions. The running direction can be reversed by connecting the terminals by means of small plates suitable for this purpose as shown in the diagram. Use electrical cables with a section that is adequate to support the current absorbed by the motor, avoiding overheating and/or any drop in electrical voltage. Prevent the cables from transmitting any mechanical stresses to the motor terminals, and at the end of all the connections, ensure that the cable clamps, terminal board covers and/or the condenser holder box are securely closed to guarantee the maximum level of protection.

Check that the drive shaft turns freely. The asynchronous single-phase motors with a caged rotor can be put into operation in most cases with direct drive, after checking the plant with regard to the current absorbed while starting up. It is advisable to always insert a means of protection (e.g. thermal relay) with a protection relay calibrated for the correct amount of current. The motor protection must not intervene as a result of the current used in starting up. We also recommend checking that the electrical voltage of the motor in use should not vary by ± 5% of its nominal voltage, and that the value of the current absorbed should not exceed that shown on the information plate. The temperature of the motor's body is not a reliable indication that it is running well. A motor that appears "cold" outside, may have greater losses, or a higher excess temperature of the winding than a motor which appears "hot" on the outside.

MAINTENANCE

The motor's running should be checked periodically for vibrations or irregular noise, and to ensure that the current absorbed is not greater than that indicated on the information plate. The fan cover should be checked to ensure that there is no obstruction of the air intake and that there is no trace of dust, oil or other impurities on the motor. During normal use, motors use pre-lubricated bearings of the type with a double shield. Being self-lubricating, they do not require any maintenance. Their duration corresponds to their technical life, which is 20,000 hours in operation, or 3 years at the longest, taking the axial and radial loads applied to the shaft into consideration, in normal environmental temperature and conditions of use.

Single phase motors series VMB 2 poles V220/60 Hz

| Motor type | Potenza Rated output | Velocità Rated speed | Tensione Rated voltage | Frequenza rated frequency | Corrente Rated current | Corrente spunto Starting current | Coppia nominale Rated torque | Coppia spunto Starting torque | Jm Motor inertia moment | Jext Load inertia moment |
|------------|----------------------|----------------------|------------------------|---------------------------|------------------------|----------------------------------|------------------------------|-------------------------------|-------------------------|--------------------------|
| series | HP KW | r.p.m. | V | Hz | A | A | Nm | Nm | Nmq | Nmq |
| VMB 56 B | 0.18 0.12 | 3280 | 220 | 60 | 1.22 | 2.90 | 0.35 | 0.21 | 0.0013 | 0.0022 |
| VMB 63 A | 0.25 0.18 | 3280 | 220 | 60 | 1.40 | 3.50 | 0.53 | 0.31 | 0.0015 | 0.0025 |
| VMB 63 B | 0.33 0.25 | 3300 | 220 | 60 | 1.80 | 4.50 | 0.74 | 0.44 | 0.0019 | 0.0032 |
| VMB 71 A | 0.50 0.37 | 3300 | 220 | 60 | 2.80 | 7.00 | 1.09 | 0.65 | 0.0028 | 0.0048 |
| VMB 71 B | 0.75 0.55 | 3360 | 220 | 60 | 4.10 | 10.2 | 1.62 | 0.97 | 0.0036 | 0.0061 |
| VMB 71 C | 1.00 0.75 | 3310 | 220 | 60 | 5.10 | 14.3 | 2.30 | 1.32 | 0.0044 | 0.0075 |
| VMB 71 D | 1.50 1.10 | 3310 | 220 | 60 | 7.70 | 20.1 | 3.23 | 1.93 | 0.0065 | 0.0110 |
| VMB 80 A | 1.00 0.75 | 3360 | 220 | 60 | 5.80 | 15.7 | 2.17 | 1.41 | 0.0070 | 0.0125 |
| VMB 80 B | 1.50 1.10 | 3360 | 220 | 60 | 8.00 | 23.2 | 3.19 | 2.07 | 0.0087 | 0.0155 |
| VMB 80 C | 2.00 1.50 | 3370 | 220 | 60 | 10.5 | 28.0 | 4.33 | 2.81 | 0.0096 | 0.0170 |
| VMB 80 D | 3.00 2.20 | 3370 | 220 | 60 | 15.0 | 39.0 | 6.35 | 4.12 | 0.0135 | 0.0216 |
| VMB 90 LA | 2.00 1.50 | 3380 | 220 | 60 | 10.0 | 29.0 | 4.32 | 2.80 | 0.0146 | 0.0234 |
| VMB 90 SA | 2.50 1.85 | 3380 | 220 | 60 | 11.8 | 35.4 | 5.33 | 3.46 | 0.0163 | 0.0260 |
| VMB 90 LC | 1.00 0.75 | 3380 | 220 | 60 | 6.00 | 15.0 | 2.00 | 1.30 | 0.0075 | 0.0125 |
| VMB 100 LA | 3.00 2.20 | 3380 | 220 | 60 | 14.2 | 47.0 | 6.34 | 4.41 | 0.0180 | 0.0450 |

Single phase motors series VMB 4 poles V220/60 Hz

| Motor type | Potenza Rated output | Velocità Rated speed | Tensione Rated voltage | Frequenza rated frequency | Corrente Rated current | Corrente spunto Starting current | Coppia nominale Rated torque | Coppia spunto Starting torque | Jm Motor inertia moment | Jext Load inertia moment |
|------------|----------------------|----------------------|------------------------|---------------------------|------------------------|----------------------------------|------------------------------|-------------------------------|-------------------------|--------------------------|
| series | HP KW | r.p.m. | V | Hz | A | A | Nm | Nm | Nmq | Nmq |
| VMB 56 A | 0.12 0.09 | 1620 | 220 | 60 | 1.10 | 2.60 | 0.54 | 0.35 | 0.0012 | 0.0023 |
| VMB 63 B | 0.25 0.18 | 1620 | 220 | 60 | 1.90 | 4.80 | 1.08 | 0.70 | 0.0026 | 0.0050 |
| VMB 71 A | 0.33 0.25 | 1630 | 220 | 60 | 2.10 | 6.20 | 1.49 | 0.97 | 0.0029 | 0.0051 |
| VMB 71 B | 0.50 0.37 | 1630 | 220 | 60 | 3.10 | 7.80 | 2.21 | 1.43 | 0.0031 | 0.0057 |
| VMB 71 C | 0.75 0.55 | 1630 | 220 | 60 | 4.20 | 10.5 | 3.28 | 2.12 | 0.0040 | 0.0073 |
| VMB 80 B | 1.00 0.75 | 1630 | 220 | 60 | 5.60 | 14.0 | 4.48 | 2.90 | 0.0030 | 0.0050 |
| VMB 80 C | 1.50 1.10 | 1630 | 220 | 60 | 7.50 | 19.0 | 6.57 | 4.28 | 0.0034 | 0.0059 |
| VMB 90 SA | 1.50 1.10 | 1660 | 220 | 60 | 7.70 | 21.0 | 6.45 | 3.87 | 0.0040 | 0.0065 |
| VMB 90 LA | 2.00 1.50 | 1660 | 220 | 60 | 10.0 | 29.0 | 8.80 | 5.28 | 0.0030 | 0.0050 |
| VMB 90 LB | 2.50 1.85 | 1680 | 220 | 60 | 11.8 | 35.0 | 10.8 | 6.43 | 0.0032 | 0.0056 |
| VMB 90 LC | 3.00 2.20 | 1680 | 220 | 60 | 14.0 | 42.0 | 12.7 | 7.65 | 0.0035 | 0.0059 |
| VMB 100 LA | 3.00 2.20 | 1680 | 220 | 60 | 13.5 | 41.0 | 12.7 | 7.65 | 0.0036 | 0.0060 |

Three phase motors series VTB 2 poles V220/380-60 Hz

| Motor type | Potenza Rated output | Velocità Rated speed | Tensione Rated voltage | Frequenza rated frequency | Corrente Rated current | Corrente spunto Starting current | Coppia nominale Rated torque | Coppia spunto Starting torque | Jm Motor inertia moment | Jext Load inertia moment |
|------------|----------------------|----------------------|------------------------|---------------------------|------------------------|----------------------------------|------------------------------|-------------------------------|-------------------------|--------------------------|
| series | HP KW | r.p.m. | V | Hz | A | A | Nm | Nm | Nmq | Nmq |
| VTB 63 A | 0.25 0.18 | 3320 | 380 | 60 | 0.63 | 2.3 | 0.53 | 1.43 | 0.0013 | 0.0032 |
| VTB 63 B | 0.33 0.25 | 3320 | 380 | 60 | 0.80 | 3.0 | 0.73 | 1.97 | 0.0019 | 0.0047 |
| VTB 63 C | 0.50 0.37 | 3340 | 380 | 60 | 1.13 | 4.3 | 1.08 | 2.91 | 0.0029 | 0.0067 |
| VTB 71 A | 0.50 0.37 | 3360 | 380 | 60 | 1.05 | 4.4 | 1.07 | 2.88 | 0.0028 | 0.0070 |
| VTB 71 B | 0.75 0.55 | 3360 | 380 | 60 | 1.55 | 6.7 | 1.59 | 4.20 | 0.0036 | 0.0090 |
| VTB 71 C | 1.00 0.75 | 3360 | 380 | 60 | 2.00 | 8.8 | 2.17 | 4.40 | 0.0044 | 0.0110 |
| VTB 80 A | 1.00 0.75 | 3400 | 380 | 60 | 1.85 | 8.5 | 2.15 | 5.42 | 0.0070 | 0.0140 |
| VTB 80 B | 1.50 1.10 | 3400 | 380 | 60 | 2.70 | 15 | 3.15 | 8.75 | 0.0087 | 0.0174 |
| VTB 80 C | 2.00 1.50 | 3410 | 380 | 60 | 3.60 | 21 | 4.28 | 10.7 | 0.0096 | 0.0192 |
| VTB 80 D | 3.00 2.20 | 3410 | 380 | 60 | 5.30 | 31 | 6.28 | 15.6 | 0.0128 | 0.0260 |
| VTB 90 S | 2.00 1.50 | 3410 | 380 | 60 | 3.30 | 18 | 4.28 | 11.0 | 0.0132 | 0.0270 |
| VTB 90 LA | 3.00 2.20 | 3410 | 380 | 60 | 4.90 | 29 | 6.28 | 16.2 | 0.0160 | 0.0330 |
| VTB 90 LB | 4.00 3.00 | 3410 | 380 | 60 | 6.70 | 41 | 8.56 | 21.4 | 0.0204 | 0.0410 |
| VTB 100 LA | 4.00 3.00 | 3410 | 380 | 60 | 6.40 | 42 | 8.56 | 22.1 | 0.0270 | 0.0540 |
| VTB 100 LB | 5.50 4.00 | 3410 | 380 | 60 | 8.70 | 61 | 11.4 | 28.5 | 0.0342 | 0.0680 |
| VTB 100 MA | 5.50 4.00 | 3410 | 380 | 60 | 8.60 | 58 | 11.3 | 29.1 | 0.0460 | 0.0710 |
| VTB 112 MB | 7.50 5.50 | 3440 | 380 | 60 | 11.6 | 81 | 15.5 | 38.8 | 0.0545 | 0.0815 |
| VTB 112 MC | 10.0 7.50 | 3440 | 380 | 60 | 15.8 | 113 | 21.2 | 53.0 | 0.0660 | 0.0990 |
| VTB 132 SA | 7.50 5.50 | 3460 | 380 | 60 | 11.4 | 75 | 14.5 | 37.2 | 0.1195 | 0.1610 |
| VTB 132 SA | 10.0 7.50 | 3460 | 380 | 60 | 15.8 | 113 | 21.2 | 53.0 | 0.1500 | 0.2250 |
| VTB 132 MC | 15.0 11.0 | 3480 | 380 | 60 | 22.5 | 158 | 30.7 | 76.7 | 0.1855 | 0.2780 |
| VTB 132 SA | 20.0 15.0 | 3500 | 380 | 60 | 31.0 | 217 | 43.7 | 105 | 0.2140 | 0.3210 |

Three phase motors series VTB 4 poles V220/380-60 Hz

| Motor type | Potenza Rated output | Velocità Rated speed | Tensione Rated voltage | Frequenza rated frequency | Corrente Rated current | Corrente spunto Starting current | Coppia nominale Rated torque | Coppia spunto Starting torque | Jm Motor inertia moment | Jext Load inertia moment |
|------------|----------------------|----------------------|------------------------|---------------------------|------------------------|----------------------------------|------------------------------|-------------------------------|-------------------------|--------------------------|
| series | HP KW | r.p.m. | V | Hz | A | A | Nm | Nm | Nmq | Nmq |
| VTB 63 A | 0.17 0.12 | 1630 | 380 | 60 | 0.50 | 1.4 | 0.71 | 1.95 | 0.0021 | 0.0054 |
| VTB 63 B | 0.25 0.18 | 1640 | 380 | 60 | 0.75 | 2.2 | 1.07 | 2.80 | 0.0026 | 0.0067 |
| VTB 63 C | 0.33 0.25 | 1640 | 380 | 60 | 0.93 | 2.8 | 1.48 | 3.80 | 0.0029 | 0.0075 |
| VTB 71 A | 0.33 0.25 | 1680 | 380 | 60 | 0.90 | 2.7 | 1.48 | 4.10 | 0.0052 | 0.0135 |
| VTB 71 B | 0.50 0.37 | 1660 | 380 | 60 | 1.20 | 3.7 | 2.17 | 5.50 | 0.0059 | 0.0179 |
| VTB 71 C | 0.75 0.55 | 1660 | 380 | 60 | 1.70 | 5.4 | 3.22 | 8.30 | 0.0091 | 0.0236 |
| VTB 80 A | 0.75 0.55 | 1670 | 380 | 60 | 1.70 | 6.5 | 3.22 | 8.80 | 0.0160 | 0.0350 |
| VTB 80 B | 1.00 0.75 | 1680 | 380 | 60 | 2.20 | 9.1 | 4.35 | 10.5 | 0.0188 | 0.0413 |
| VTB 80 LA | 3.00 2.20 | 1680 | 380 | 60 | 3.00 | 12.9 | 6.38 | 14.6 | 0.0230 | 0.0555 |
| VTB 90 S | 1.50 1.10 | 1680 | 380 | 60 | 2.80 | 12.6 | 6.38 | 14.9 | 0.0204 | 0.0450 |
| VTB 90 LC | 2.00 1.50 | 1680 | 380 | 60 | 3.70 | 17.4 | 8.70 | 19.5 | 0.0240 | 0.0530 |
| VTB 90 LC | 3.00 2.20 | 1680 | 380 | 60 | 5.40 | 27.0 | 12.8 | 28.4 | 0.0330 | 0.0725 |
| VTB 100 LA | 4.00 3.00 | 1680 | 380 | 60 | 5.30 | 28.0 | 12.7 | 29.4 | 0.0457 | 0.1005 |
| VTB 100 LB | 4.00 3.00 | 1690 | 380 | 60 | 7.20 | 38.0 | 17.9 | 40.7 | 0.0566 | 0.1245 |
| VTB 112 MA | 5.50 4.00 | 1700 | 380 | 60 | 9.30 | 54.0 | 22.9 | 53.0 | 0.1180 | 0.2124 |
| VTB 112 MB | 7.50 5.50 | 1710 | 380 | 60 | 12.7 | 76.0 | 31.3 | 71.4 | 0.1600 | 0.2880 |
| VTB 132 SA | 7.50 5.50 | 1720 | 380 | 60 | 12.0 | 79.0 | 31.0 | 73.6 | 0.2330 | 0.4190 |
| VTB 132 MA | 10.0 7.50 | 1740 | 380 | 60 | 16.0 | 109 | 42.0 | 96.5 | 0.2700 | 0.4860 |
| VTB 132 MB | 12.5 9.20 | 1740 | 380 | 60 | 20.0 | 140 | 51.5 | 118 | 0.3450 | 0.6210 |
| VTB 132 MC | 15.0 11.0 | 1750 | 380 | 60 | 24.0 | 168 | 61.2 | 141 | 0.3800 | 0.6850 |


SPARE PARTS

Spare parts may be supplied on request, quoting the type of motor as indicated on the information plate.




WARNING!

In order to move the larger motors, their bodies have been fitted with holes in order to insert suitable eye-bolts. Do not lift the motor together with any devices attached to it when it is being put into operation.

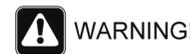

WARNING!

Any type of work should only be carried out on the machine while it is disconnected from the electrical supply. The assembly and dismantling of the connecting components and the bearings must be carried out using the methods and equipment suitable for the task. The motor must eventually be dismantled by detaching the motor from the components connecting it to the machine being operated.

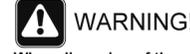

WARNING!

When disposing of the motor at the end of its active life, pay attention to the requirements of the laws in force, taking account of the fact that all the materials that the electric motors are made from can be recycled.



WARNING!

The electric motor is a product intended to be incorporated with other machines, or used in industrial areas. Therefore, additional safety measures must be taken whenever more restrictive protective conditions are necessary.




WARNING!

Disconnect the electrical supply before carrying out any operations on the motor. Pay attention to any heating units which may be supplied separately with electrical power.

CONNECTION DIAGRAMS

SERIES VMB/VMC SINGLE-PHASE ASYNCHRONOUS MOTORS

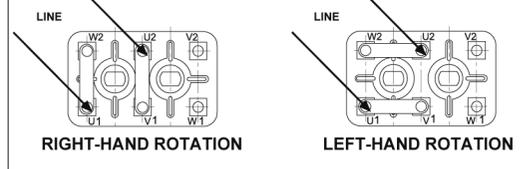

SERIES VT1-2VTB 3VTB / VTB / VDV THREE-PHASE ASYNCHRONOUS MOTORS

